• ODOMETER—ODOMETER AND TRIP METER STICK—WILL NOT OPERATE AND/OR "CLICKING" NOISE—VEHICLES BUILT 3/14/96 THROUGH 9/13/96

• NOISE—"CLICKING" NOISE FROM ODOMETER OR TRIP METER—INOPERATIVE—VEHICLES BUILT 3/14/96 THROUGH 9/13/96

FORD: 1996 MUSTANG

This TSB article is being republished in its entirety to provide an alternate phone number to call.

ISSUE

The odometer and trip meter may stick, be inoperative and/or make a "clicking" noise due to an ungreased stepper motor worm gear.

ACTION

For noise concerns, apply silicone grease to the stepper motor worm gear. Refer to the following text for service details.

If a concern with a stuck odometer is present, call 1-800-482-0439 or 1-313-843-8250, Ext. 645 and order an Odometer Service Kit (SSP1212), or a written request may be made to F. B. Wright, 9999 Mercier Ave., Dearborn, MI 48120. Ordered kits will be shipped overnight delivery. Refer to Instruction Sheet 7221, included in the kit, for the detailed service procedure.

OTHER APPLICABLE ARTICLES: NONE SUPERSEDES: 97-4-2		
WARRANTY STATUS: Eligible Under The		
	Provisions Of Bumper To	
	Bumper Warranty Coverage	
OPERATION	DESCRIPTION	TIME
970506A	Remove And Install	0.7 Hr.
	Speedometer And	
	Lubricate	
DEALER CODING		
		CONDITION
BASIC PART NO.		CODE
17C290		51

OASIS CODES: 204000, 204200, 702000

Article No. 97-5-6