

- **BLOWER MOTOR—“CHIRPING” OR “SQUEAKING” FROM BLOWER MOTOR AT LOW SPEEDS**
- **NOISE—“CHIRPING” OR “SQUEAKING” FROM BLOWER MOTOR AT LOW SPEEDS**

**Article No.
97-25-5**

FORD: 1984-1994 TEMPO
 1986-1997 TAURUS
 1989-1997 THUNDERBIRD
 1991-1997 ESCORT
 1994-1997 MUSTANG
 1995-1997 CONTOUR
 1992-1997 AEROSTAR
 1995-1997 WINDSTAR
 1997 EXPEDITION, F-150, F-250 LD

LINCOLN: 1986-1997 CONTINENTAL
 1993-1997 MARK VIII

MERCURY: 1984-1994 TOPAZ
 1986-1997 SABLE
 1989-1997 COUGAR
 1991-1997 TRACER
 1995-1997 MYSTIQUE
 1993-1997 VILLAGER

This TSB article is being republished in its entirety to correct the supersede article reference.

ISSUE

Some vehicles may exhibit a “squeaking” or “chirping” from the blower motor at low blower motor speeds. This may be caused by uneven brush friction on the commutator surface of the motor.

ACTION

Replace the blower motor with a revised blower motor which has improved brush-to-commutator friction. Refer to the appropriate model/year Service Manual for removal and installation procedures.

Article No. 97-25-5 Cont'd.

PART NUMBER	PART NAME
F4DZ-19805-CA	A/C Blower Motor (1986-94 Taurus/Sable, Continental)
F6DZ-19805-CA	A/C Blower Motor (1995-97 Taurus/Sable)
F7OZ-19805-BA	A/C Blower Motor (1995-97 Continental)
F4SZ-19805-HA	A/C Blower Motor (1989-97 Thunderbird/Cougar, 1993-96 Mark VIII)
F7LZ-19805-CA	A/C Blower Motor (1997 Mark VIII)
F7CZ-19805-EA	A/C Blower Motor (1991-97 Escort/Tracer)
F7ZZ-19805-BA	A/C Blower Motor (1994-97 Mustang)
F43Z-19805-JA	A/C Blower Motor (1984-94 Tempo/Topaz)
F7RZ-19805-DA	A/C Blower Motor (1995-97 Contour/Mystique)
F68Z-19805-FC	A/C Blower Motor (1995-97 Windstar - Front)
F78Z-19805-BA	A/C Blower Motor (1995-97 Windstar - Rear Auxiliary)
F49Z-19805-A	A/C Blower Motor (1992-97 Aerostar - Front)
F6XZ-19805-BA	A/C Blower Motor (1993-97 Villager) - Front
F49Z-19805-C	A/C Blower Motor (1992-97 Aerostar, 1993-97 Villager) - Rear Auxiliary
F75Z-19805-FA	A/C Blower Motor (1997 F-150/F-250 LD, Expedition) - Front

(Cont'd.)

PART NUMBER	PART NAME
F75Z-19805-EA	A/C Blower Motor (1997 Expedition) - Rear Auxiliary

OTHER APPLICABLE ARTICLES: NONE

SUPERSEDES: 97-23-4, 97-6-10

WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage For 1992-97 Model Year Vehicles And 1991 Continental, Basic Warranty Coverage For All Other Model Year Vehicles

OPERATION	DESCRIPTION	TIME
972505A	Replace Blower Motor - All Vehicles	Refer to SLTS Manual

DEALER CODING

BASIC PART NO.
19805

CONDITION
CODE
14

OASIS CODES: 208000, 208300, 208999, 702000, 702300